

VC3

VC1

VC2

L3

C8

L10


L8
L6
L4

L1

L2



V3

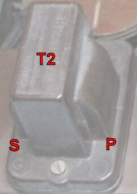

T2

S

P



V2

L9

L5

L7




V1

C1



Tone correction circuit 22k & 2.2nF across T2 secondary

KB Museum.org.uk

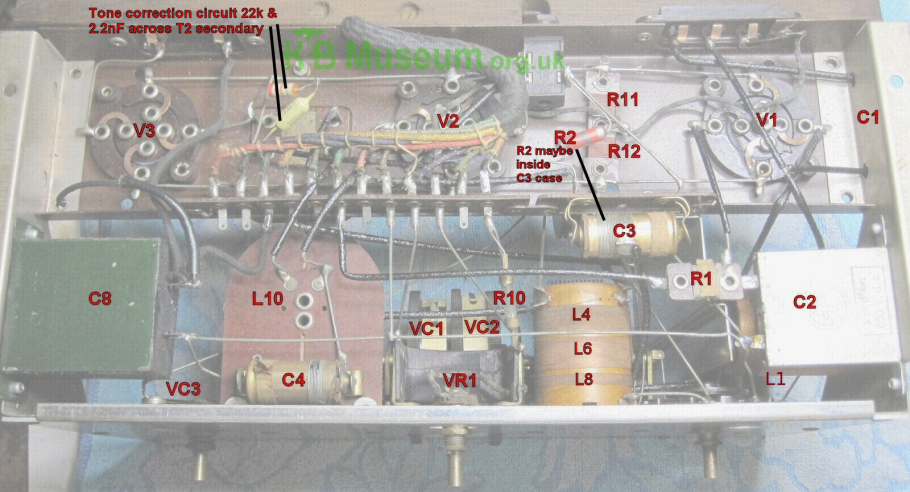

V3

V2

R11

V1

C1

R2

R12

R2 maybe inside C3 case

C3

C8

L10

R10

R1

C2

VC1

VC2

L4

L6

L8

L1

VC3

C4

VR1

This circuit has been drawn from a working radio. There may be errors in the drawing so please check your own wiring

Inter Chassis Wiring Loom

Drawn by D. Pye

March 2017

Kolster-Brandes 169

3 Valve Plus Rectifier AC Mains TRF Receiver

